

Greg Fisher

From: MToigo@hako.com
Sent: Monday, November 14, 2016 4:41 AM
To: fisher.g@minutemanintl.com
Subject: WG: FW: Apex 58
Attachments: image001.png; image002.png; image003.png; IMG_09441.jpg; IMG_09301_1478050652582.3gp; Lever Hopper.jpg

Greg,
sorry for late answering, but I had to check this in the production. There are no engineering instructions about this "hook". It is more or less knowledge of the workers at the assembly line.

There are two possibilities to adjust the length of the lever and with this the position of the "hook". The joint Pos.11 is fixed in a hole in the bracket at the machine frame (not shown in the picture, but I mean the thread where the shim Pos.10 is shown). In the bracket are totally 3 holes. So you may find a better mounting position. Secondly you can extend the thread of the mounting at the joint (to Pos.13).
If the problem is not the length, if it is the height where the "hook" is stopping. You can change this by shortening the thread at the second Pos.11 (the one at the hook).

Freundliche Grüße / Best Regards

Markus Toigo

Hako GmbH
Kundendienst/Service (KUD)

Hamburger Straße 209-239
D-23843 Bad Oldesloe

Tel.: 04531 806-397
Fax: 04531 806-484
eMail: mtoigo@hako.com
Internet: <http://www.hako.com>

----- Weitergeleitet von Markus Toigo/Hako-Werke/Hako am 14.11.2016 11:34 -----

Von: Markus Toigo/Hako-Werke/Hako
An: Stephan Bern/Hako-Werke/Hako@Hako
Datum: 08.11.2016 08:20
Betreff: WG: FW: Apex 58

Stephan,
kennst Du so etwas?
Gibt es da eine Einstellvorschrift?

Freundliche Grüße / Best Regards

Markus Toigo

Hako GmbH
Kundendienst/Service (KUD)

Hamburger Straße 209-239
D-23843 Bad Oldesloe

Tel.: 04531 806-397
Fax: 04531 806-484
eMail: mtoigo@hako.com
Internet: <http://www.hako.com>

----- Weitergeleitet von Markus Toigo/Hako-Werke/Hako am 08.11.2016 08:25 -----

Von: "Greg Fisher" <fisher.g@minutemanintl.com>
An: <MToigo@hako.com>
Datum: 07.11.2016 23:42
Betreff: FW: Apex 58

Markus,

Hopper dump door won't lock in place. User has to push latch a little for it to lock. New unit, right off the skid. Is there an adjustment for this?

Please advise.

Thanks,

Greg Fisher
Technical Support Specialist
Minuteman International
14N845 US Rt.20, Pingree Grove, IL 60140
Office 800-323-9420 x-2500 Option #3
Fax: 800-422-6933
Parts Manuals are available
at <http://manuals.minutemanintl.net/>

The information contained in this transmission is privileged and/or confidential information intended for the use of the individual or entity named above. If the reader of this message is not the intended recipient, you are hereby notified that any dissemination, distribution or copying of this communication is strictly prohibited. If you are not the intended recipient, please contact the sender by reply email and destroy all copies of the original message. Thank you

From: Eric Schmidt [<mailto:schmidt.e@powerboss.com>]
Sent: Monday, November 7, 2016 3:31 PM
To: Greg Fisher <fisher.g@minutemanintl.com>
Subject: Apex 58

Adjustment to lock Hopper in?

Eric Schmidt
714-348-3764
Western Regional Manager
PowerBoss
14N845 US HWY 20
Pingree Grove, IL 60140

Die Firma ist eine Gesellschaft mit beschränkter Haftung (GmbH),
Sitz Bad Oldesloe, Registergericht : Lübeck HR B 1314 OD
UST-ID: DE 812558589, Steuernummer: 3029225427
Geschäftsführer: Mario Schreiber (Vorsitzender), Uwe Brenne, Tilo Sigeneger, Matthias Wolf
Vors. des Aufsichtsrates: Uwe Lüders

The company is limited by shares (GmbH), Head office Bad Oldesloe, Germany
Registry court : Lübeck Comm. register/ HR B 1314 OD
VAT-ID: DE 812558589, Tax No.: 3029225427
Members of the Board: Mario Schreiber (Chairman), Uwe Brenne, Tilo Sigeneger, Matthias Wolf
Chairman of the Supervisory Board: Uwe Lüders