

TECHNICAL SERVICE BULLETIN

To: All [Distributor/Customer]


From: PowerBoss Technical Support

Date: 3/29/2024

Subject: TSB for Scrubmaster B400RH-Checking/Replacing washers on A04 Drive Controller


Reason for Change

Please travel immediately to the machines on the list and check whether the correct washers have been installed on the drive control fuse. Incorrect washers can cause short-term damage to the drive controller.

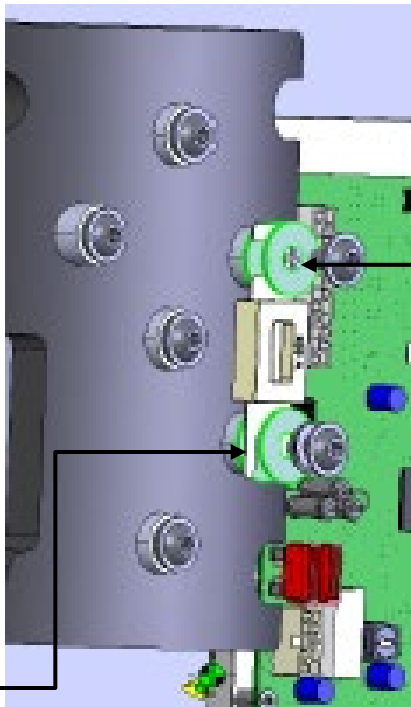

Improvement

Up to 4pcs washers ISO 7093-8-200HV-A4-70 with the **spare part number #730526** must be replaced. The screws must be tightened with **9.5 Nm**.

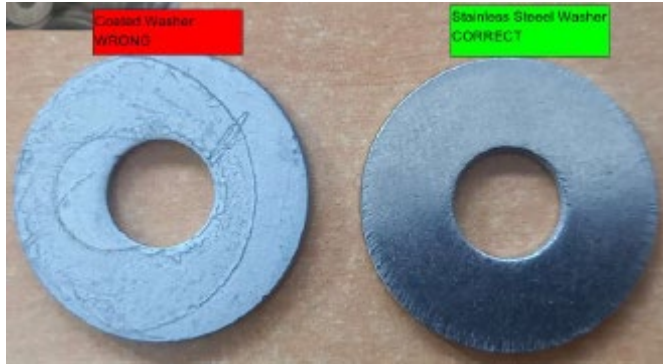

Models/Serial Numbers Affected

R71907000733, R71907000743, R71907000753, R71907000763, R719000773, R71907000783, R71907000793, 719000303505, 719000303515, 719000303545, 719000303555, R71907000804, R71907000814, R71907000824, R71907000834, R71907000844, R71907000854, R71907000864, R71907000874, R71907000884.

Special Instructions – This check/rework needs to be completed no later than April 30th, 2024.

Compensation – For Installation Procedure

Working Hours: 1 Hour

Travel Time: 1 Hour

KUD 2024-08 - Confirmation Form

Instructions: Fill out form (below) and return to techsupport@powerboss.com

Informational Only For Purchase Warranty Product Improvement

Confirmation of checking the washers at drive controller

I hereby confirm that the Scrubmaster B400 with the serial number

_7190_____ was checked on _____ / _____ /2024

Drive controller front:

Washers at fuse

okay

changed

Drive controller rear:

Washers at fuse

okay

changed

Service Technician

Date