

# NEWS

KUD 2020-17  
20.10.2020



*Confidential -  
for internal use only!*

## **Hako-Citymaster 1600**

### **Maintenance of the accelerator pedal every 500 hours of operation**

**Affected vehicles: all Hako-Citymaster 1600 (1491.01 und 1491.02)**

Dear Sir or Madam,

we would like to remind you of our newsletter KUD 2020-03 **“Maintenance of the accelerator pedal, every 500 hours of operation “**.

It is essential to grease the plain bearing bushes (see annex I, position no. 2) and the bolts (see annex I, position no. 21) every 500 hours of operation. For this purpose, you should use WD40 or a similar multi-function oil. After the parts are greased, please check whether the pedals can be easily operated and if they return to zero position independently through the springs.

**In case of a failed test, strong corrosion, a mechanical defect of the pedals or in case that the pedals do not return to zero position, pedals must be replaced for safety reasons!**

**You can obtain the accelerator pedal in our shop – the spare part number is 01495570.**

Please inform your employees, sales partners and customers, who maintain their vehicles themselves.

Hako GmbH

André Meier  
After Sales Service

Annex:

Annex I: KUD 2020-17