

TECHNICAL SERVICE BULLETIN

To: [Distributor/Customer]

From: PowerBoss Technical Support

Date: 8/29/2022

Subject: Preventative Maintenance on the Chemical Dosing Pump on the Scrubmaster B120R series scrubber, part #01270770.




Models/Serial Numbers Affected

Scrubmaster B120R

Reason for Maintenance

Non-Usage or allowing chemical residue to lay static in flow hose can cause blockage or hose collapse.

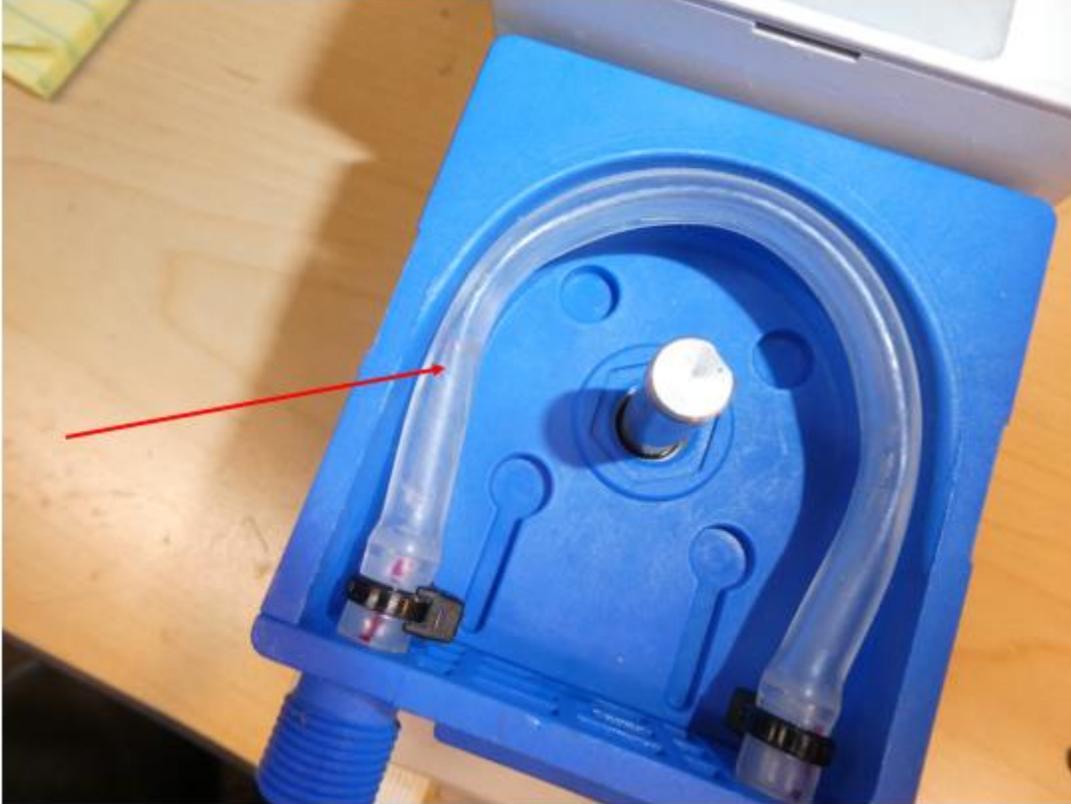


Action to be Taken

- 1) Remove clear cover and blue cam cover



- 2) Remove Cam and zip ties and feed hose

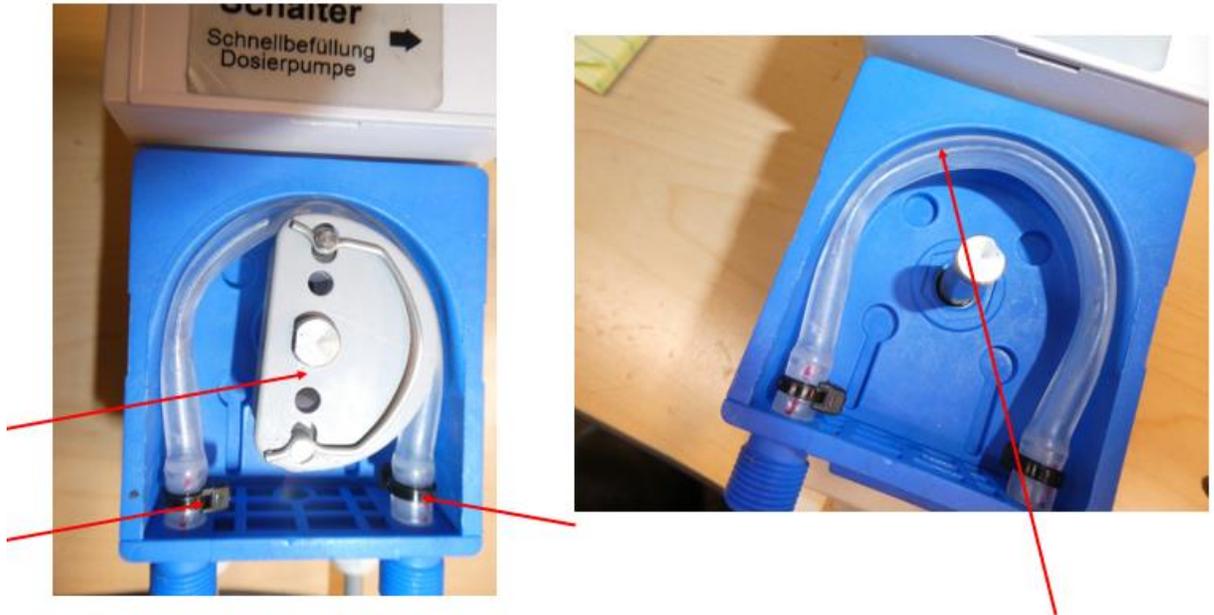

- 3) Once hose is removed wash and rinse out with white vinegar and massage kink out of affected area, reassemble and return to service.

Maintenance Interval

Should be done every 200 machine hours.

Informational Only For Purchase Warranty Product Improvement

For further assistance, questions, or comments contact Technical Support at 800-323-9420 (USA)